

febi 22350


To fit:

Mercedes-Benz Trucks Actros I, Actros II & III,
Arocs, Axor I & II
Repl. no. 948 350 30 05



EN

V-Stay

Problem

Premature wear of the V-stay central bearings.

Cause

The rivets holding the V-stay mounting brackets to the chassis can be subject to excessive stress if the vehicle is overloaded or the vehicle is travelling on bad road surfaces. Play maybe experienced at the bearing mounting brackets caused by wear on the retaining rivets or the rivets missing completely. Even a minimum amount of play will cause central bearing to fail due to the additional stress being transferred.

Solution

Before repairing or fitting a new febi 22350 V-stay, check for missing or loose rivets and replace as required. If rivets are missing, they can be replaced with suitable bolts. febi recommend that 26709/26710 thread lock is used to prevent the bolts from becoming loose.

The complete range of steering and suspension parts can be found at: partsfinder.bilsteingroup.com